






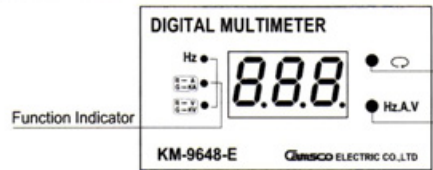

# DIGITAL MULTIMETER

## KM-9648 SERIES

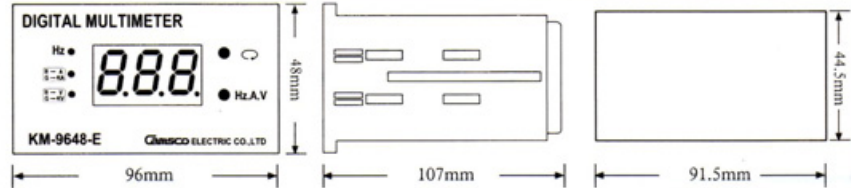

DISPLAY		Red high efficiency LED high 14.22mm (.56")
ACCURACY		± 0.5% ± 2 digit
OPERATING CONDITION		-10°C~50°C (20% to 90% RH non-condensed)
DIELECTRIC STRENGTH		AC 2KV/1min
AUX · POWER		AC110V/220V 50/60Hz
MEASUREMENT RANGE	KM-9648A	<p><b>Ranges:</b>            Direct Measurement Current: AC 0 – 5A.            For Current above 5A, Current Transformer (C.T.) must be used.            Press Key  to select desirable C. T. Ratio.            The following are the available C.T. Ratios:            10A/5A, 15A/5A, 20A/5A, 25A/5A, 30A/5A, 40A/5A, 50A/5A, 60A/5A, 70A/5A, 75A/5A, 80A/5A, 100A/5A, 120A/5A, 150A/5A, 160A/5A, 200A/5A, 250A/5A, 300A/5A, 400A/5A, 500A/5A, 600A/5A, 700A/5A, 750A/5A, 800A/5A, 1kA/5A, 1.2kA/5A, 1.5kA/5A, 1.6kA/5A, 2kA/5A, 2.5kA/5A, 3kA/5A, 4kA/5A, 5kA/5A, 6kA/5A, 7kA/5A, 7.5kA/5A, 8kA/5A.            Note: Red LED indicates Ampere. Green LED indicates Kilo-ampere (kA).            Voltage: AC 50-600V.</p>
	KM-9648V	<b>Range:</b> AC 50-600V.
	KM-9648Hz	<b>Frequency:</b> 1-99.9Hz. <b>Input voltage:</b> AC 50-600V.
	KM-9648AV	<p><b>Ranges:</b>            Direct Measurement Current: AC 0 – 5A.            For Current above 5A, Current Transformer (C.T.) must be used.            Press Key  to select desirable C. T. Ratio.            The following are the available C.T. Ratios:            10A/5A, 15A/5A, 20A/5A, 25A/5A, 30A/5A, 40A/5A, 50A/5A, 60A/5A, 70A/5A, 75A/5A, 80A/5A, 100A/5A, 120A/5A, 150A/5A, 160A/5A, 200A/5A, 250A/5A, 300A/5A, 400A/5A, 500A/5A, 600A/5A, 700A/5A, 750A/5A, 800A/5A, 1kA/5A, 1.2kA/5A, 1.5kA/5A, 1.6kA/5A, 2kA/5A, 2.5kA/5A, 3kA/5A, 4kA/5A, 5kA/5A, 6kA/5A, 7kA/5A, 7.5kA/5A, 8kA/5A.            Note: Red LED indicates Ampere. Green LED indicates Kilo-ampere (kA).            Voltage: AC 50-600V.</p>
	KM-9648E	<p><b>Ranges:</b>            Direct Measurement Current: AC 0 – 5A.            For Current above 5A, Current Transformer (C.T.) must be used.            Press Key  to select desirable C. T. Ratio.            The following are the available C.T. Ratios:            10A/5A, 15A/5A, 20A/5A, 25A/5A, 30A/5A, 40A/5A, 50A/5A, 60A/5A, 70A/5A, 75A/5A, 80A/5A, 100A/5A, 120A/5A, 150A/5A, 160A/5A, 200A/5A, 250A/5A, 300A/5A, 400A/5A, 500A/5A, 600A/5A, 700A/5A, 750A/5A, 800A/5A, 1kA/5A, 1.2kA/5A, 1.5kA/5A, 1.6kA/5A, 2kA/5A, 2.5kA/5A, 3kA/5A, 4kA/5A, 5kA/5A, 6kA/5A, 7kA/5A, 7.5kA/5A, 8kA/5A.            Note: Red LED indicates Ampere. Green LED indicates Kilo-ampere (kA).            Voltage: AC 50-600V.            Frequency: 1-99.9Hz.</p>
STANDARD FEATURES	 <p>Function Indicator</p> <ul style="list-style-type: none"> <li>• This key is for selecting C.T. ratio.</li> <li>• This Key for setting measuring function. (Hz – A – V)</li> </ul>	
DIMENSION	 <p>96mm      107mm      91.5mm</p> <p>48mm      44.5mm</p>	